


Main voltage: 3VDC、 6VDC、 9VDC、 12VDC、 24VDC、

Typical applications: Pan/Tilt cameras, Grill, Oven, Cleaning machine, Garbage disposers, Packing bank note machine, Coffee machine, Medical machine, Manostat, Amusement equipment, infusion pumps, Office equipment, Household appliances, Automatic

Weight: 520~760g/pcs(approx)

Packing details: CTN size: 34X31XH15cm 20pcs/CTN G.W.16Kgs

APPEARANCE SIZE

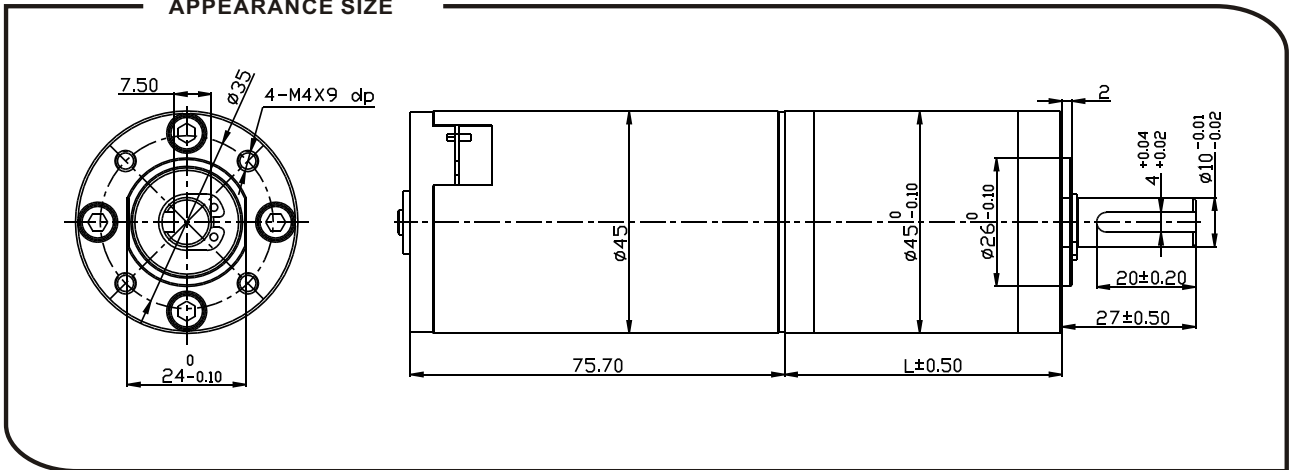

Gearbox data:

Number of stages	1 stages reduction	2 stages reduction	3 stages reduction	4stages reduction	5stages reduction
Reduction ratio	3.7, 5.2	13.7, 19.2, 26.9	50.9, 71.2, 99.5, 139	188, 264, 369, 516, 721	699, 977, 1367, 1911, 2672, 3736,
Gearbox length "L" mm	33.6	44.9	56.2	67.5	78.8
Max. Running torque	6.0Kgf • cm	12Kgf • cm	20Kgf • cm	30Kgf • cm	50Kgf • cm
Max. Gear breaking torque	18Kgf • cm	36Kgf • cm	60Kgf • cm	90Kgf • cm	150Kgf • cm
Max. Gearing efficiency	90%	81%	73%	65%	59%

Motor data:

Motor name	Rated Volt. V	No load		Load torque				Stall torque	
		Current	Speed	Current	Speed	Torque	Output power	Torque	Current
		mA	r/min	mA	r/min	gf • cm	W	gf • cm	A
45ZY123000	12	≤250	3000	≤1700	2200	550	12.0	2200	6.5
45ZY124500	12	≤400	4500	≤3600	3300	800	26.4	3200	12.5
45ZY126000	12	≤700	6000	≤6900	4500	1100	49.5	4400	25
45ZY243000	24	≤180	3000	≤850	2200	550	12.0	2200	6.5
45ZY244500	24	≤280	4500	≤1800	3300	800	26.4	3200	6.3
45ZY246000	24	≤350	6000	≤3500	4500	1100	49.5	4400	13

1. This table lists some motors parameters, others please refer to specific parameters of Page 153.
2. After connecting motor and gearbox which is named gearmotor the output torque: motor torque X reduction ratio X gearing efficiency; output speed: motor speed / reduction ratio.